

Vehicle Description

DATE INSPECTED: 12/11/2020

2008 Holden Combo Van 1.4 LT Automatic STOCK#146333

VIN	W0L0XCF2594062747
Compliance Date	5/2009
Build Date	Not located
Odometer Reading	133435
Registration Number	1RY9XK
Registration Expiry	03/10/2021
Last Serviced	27/10/2020



Overall Rating

Note: 5 Star ratings are usually reserved to near new and ex-factory driven demonstrator vehicles



Seats



Suspension



Lights



Brakes



Engine



Body & Paint



Mountings



Tyres



Transmission / Gearbox



Road Test



Steering



Other



Seats

Very minimal wear to seats and trims, in good condition for age and kilometres travelled with commercial type use



Lights

All lights and lamps are operational and in good condition, free of cracks or moisture at time of inspection



Engine

Engine/engine bay is in very good/well maintained condition at time of inspection. No diagnostic fault codes found at time of inspection. Minor oil sweating from upper engine area - follow up with dealer



Mountings

Mountings are in good condition for age and kilometres.



Transmission / Gearbox

Transmission selecting gears correctly and smoothly at time of inspection



Steering

Steering turning lock to lock smoothly at time of inspection.



Suspension

All visible suspension and suspension bushes in good condition reflecting kilometres and age. Left hand front and right hand front stabiliser link rubbers are split - follow up with dealer



Brakes

Front and rear brakes wearing consistent with age and kilometres of the vehicle



Body & Paint

Body and paint in good condition with very minimal superficial imperfections to be expected with age and kilometres travelled with commercial use



Tyres

Front tyres approximately 6mm tread depth Rear tyres approximately 8mm tread depth Wheels are in good condition, free of gutter rash



Road Test

Vehicle performed well on road test



Other

Overall




General Comments

Overall this vehicle has been rated as '3 STARS' taking into consideration age and kilometres travelled. Vehicle is in average condition requiring repairs. Possible minor inclusions and imperfections to be expected with a vehicle of these kilometres and age which is used for commercial use.







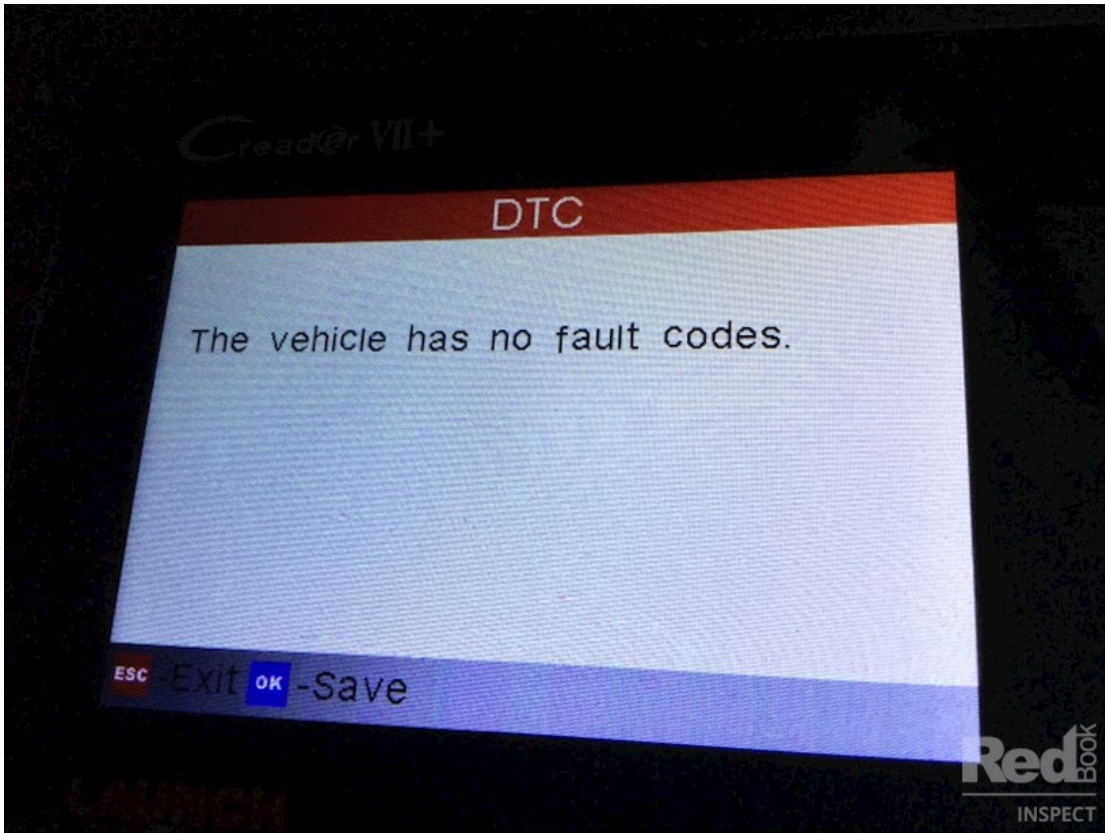







RedBook
INSPECT

This vehicle has been thoroughly checked in accordance with the 135,000 km/12 month service.

Service validation
135,000 kms or
12 months
Since last service
(which ever occurs first)

Service Dealer Additional services performed

Brake fluid changed: YES/NO Coolant changed: YES/NO

Clutch fluid changed: YES/NO N/A (not applicable)

Date of service. 27/10/20 Odometer... 133419 **Melbourne's Cheapest Cars Pty Ltd**

Signed LMCT: 8309 ABN: 92.170.958.389

648 South Road Moorabbin Vic 3189

T: (03) 9556 0777 F: (03) 9556 8768

SERVICE COUPON 135,000 km or 12 months
from the last service (whichever occurs first)

authorise performance of the services specified and understand that I will be charged for the time, parts and labour listed.

1.5 hours labour
engine oil and filter change

Signature..... Date.....

Note if the owner of this vehicle has changed since last service, refer to the change forms at the front of this book

Under bonnet

- Change engine oil and filter.
- Check fluid levels: brake, clutch and washer. Check with tester and check level (pressure test if level low)
- Check the accessory drive belts for adjustment and fluid reservoirs, air ducts, all hoses and clamps.
- Check battery/terminals for corrosion (clean as required) battery terminals and hold down clamp for security.

There will also be a charge for additional services as follows:

Item Ratings

★★★★★ 5.0 **VERY GOOD**

★★★★☆ 4.5 Item found to be in working order and/or no obvious signs of damage/degradation, consistent with age & kms of vehicle.

★★★★☆ 4.0 **GOOD**

★★★☆☆ 3.5

★★★☆☆ 3.0 **FAIR**

★★★☆☆ 2.5 Item found to be in working order with some signs of damage and/or wear & tear, consistent with age & kms of vehicle.

★★☆☆☆ 2.0 **POOR**

★★☆☆☆ 1.5

★☆☆☆☆ 1.0 **VERY POOR**

★☆☆☆☆ 0.5 Item found not to be in working order and/or major signs of damage and/or wear & tear.

NA NOT APPLICABLE

Vehicle does not have this item fitted/installed.

NC NOT CHECKED

Potential defect observed but item not further investigated/dismantled.

RedBook Inspect does not check the following items

- Brake function and lining material, brake drums, limited to what is immediately visible
- Evidence of brake fluid contamination
- Anti-lock braking system (ABS) mechanics
- Meters indicating oil and fuel consumption or the degree of oil and fuel consumption
- Reason for oil leaks
- Oil pump strainer to assess sludge build up
- Wheel cylinders
- Vehicle electrics and electronics
- Transmission mechanics
- Engine cylinder compression
- Engine mountings
- Water pump/fan
- Body water leaks or reason for leaks
- Odometer and camshaft belt, drive belt and timing belt
- Estimated expiry of exhaust system, clutch, dual mass flywheels
- Standard to which repairs or service history have been completed
- Functionality of audio-visual or entertainment system including CD, Cassette, TV, DVD, iPod connectivity, sensors, alarm/security devices, satellite navigation systems/GPS
- Degree of gas emissions
- Catalytic converters
- Additional accessories included as a result of owner's modifications
- Mechanical switching of wipers and lights
- LPG systems
- Air conditioning efficiency
- Status of habitation areas of motorhomes or caravans
- Vehicle's computer systems, such as trip meter computers, cruise control and any other computer systems
- Technical systems

Disclaimer

- (a) This report is not a warranty.
- (b) The scope of this inspection is visual only and limited to the items checked in the body of the report on the date of inspection, reflecting the age of the vehicle and kilometres travelled on that date. As the inspection is visual only, it does not involve the removal of any parts or components and is therefore limited in scope.
- (c) It is the responsibility of the buyer to check and diligence the vehicle at time of purchase.
- (d) RedBook Inspect assumes no liability or warranty for any defects that may arise subsequent to the date of inspection.
- (e) This report must not be sold or provided to any third party, except with RedBook Inspect's prior written consent.